CHARLE REPES MARK PACTURING DR:	CHANCE RIDES MANUFACTURING, INC.	Bulletin No:	B102CRM157-0
	4200 Walker	Release Date:	April 2, 2008
	Wichita, KS 67277-2328	Effective Date:	April 2, 2008
	U.S.A.	Supersedes:	N/A
	Phone: 1-316-942-7411 • FAX: 1-316-942-2012		
	Website: www.rides.com	Completion Date:	June 2, 2008
	E-mail: rides@rides.com	Page:	1 of 4

SERVICE BULLETIN

Ride Manufacturer: CHANCE RIDES MANUFACTURING, INC.

Affected Production Dates: All

Ride Name: C.P. HUNTINGTON

Affected Serial Nos.:

All Units With Ford 2.5L Engine

Model No.: 102

Abstract of Issue:

Air Compressor Bracket Rework

Reason For Release:

The fasteners for the air compressor mounting bracket used on the above noted C.P. HUNTINGTON locomotives can become loose over time from vibration. Loose fasteners can result in possible damage to the bracket, compressor and even the engine block if the locomotive is operated in this condition.

Extra attention to these fasteners is necessary to make sure that they are tightened properly and remain tight. A kit has been developed to help ensure that the fasteners remain tight.

Action to be Taken:

Owner/operators of the above noted C.P. HUNTINGTON trains are required to order and install the Air Compressor Fastener Rework Kit within 60 days of the release date on this bulletin. The kit will be provided at no charge during this timeframe.

Order the Air Compressor Bracket Rework Kit, part number K102CRM157-0, which includes all parts necessary for one locomotive.

Once the kit is installed, the fasteners must be inspected monthly. Installation procedures are provided on the following pages of this bulletin.

All work must be performed by qualified personnel, capable of understanding the function of the parts and their proper installation. Use only those components authorized, specified or provided by Chance Rides Manufacturing, Inc. All applicable OSHA safety standards and safe industry practices must be observed.

Observe all safety information contained in the manufacturer's manuals. Make available this bulletin and all related technical information to personnel using the equipment.

Chance Rides Manufacturing, Inc. issues notifications for the benefit of owners of amusement rides manufactured by Chance Rides Manufacturing, Inc. As a service to the industry, and in the interest of employee and public safety, Chance Rides Manufacturing, Inc. also issues notifications for the benefit of owners of amusement ride equipment for which the manufacturer no longer exists, such as the Allan Herschell Company, Chance Manufacturing Co., Inc., Chance Rides, Inc., etc. In doing so, Chance Rides Manufacturing, Inc. does not assume liability for losses associated with amusement ride equipment built by manufacturers other than Chance Rides Manufacturing, Inc.

CRM	CHANCE RIDES MANUFACTURING, INC. 4200 Walker Wichita, KS 67277-2328 U.S.A.	Bulletin No:	B102CRM157-0		
		Release Date:	April 2, 2008		
		Effective Date:	April 2, 2008		
		Supersedes:	N/A		
CHANCE RIDES MANUFACTURING, INC.	Phone: 1-316-942-7411•FAX: 1-316-942-20	2			
	Website: www.rides.com	Completion Date	e: June 2, 2008		
	E-mail: rides@rides.com	Page:	2 of 4		
Ride Manufacturer: CHANCE RIE	DESMANUFACTURING, INC. Affected	Production Dates: A	11		
Ride Name: C.P. HUNTIN	NGTON Affected		Units With d 2.5L Engine		
Model No.: 102					
Detail of Issue (continued):					
The Air Compressor Fastener Rework Kit , part number K102CRM157-0, contains the following: Part Number Component Quantity					
27534500 Stud - M10-1.5 x 92mm 1 28538802 Special Locking Washer (set*) - 10mm 4 28538801 Special Locking Washer (set*) - 8mm 1 60668510 Capscrew - M10-1.5 x 35mm 1 60668504 Capscrew - M10-1.5 x 40mm 2 60684902 Capscrew - M8-1.25 x 40mm 1 64748802 Nut - Hex 10mm-1.5 1 * The special locking washer set consists of two washers. Refer to the installation details on page 4 of this bulletin.					
 Installation Instructions Remove the old fasteners one at a time and replace with the fasteners exactly as shown in the following illustration. Discard the old fasteners - DO NOT RE-USE. 					
IMPORTANT: Inspect the condition of each tapped holes in the engine block. Look for corrosion, wear, stripped threads or any other signs of damage. If damage is found contact the Customer Service Department at CHANCE RIDES MANUFACTURING, INC. for the proper repair procedure before proceeding. All threaded holes must be clean and in good condition.					
	s of the capscrews provided may vary sligh SE ONLY THE FASTENERS PROVIDED		inally installed at the		
2. As each fastener is installed, tighten it to the torque specifications shown on page 4.					
3. Use a torque wrench to check the tightness of these fasteners monthly.					

		Bulletin No:	B102CRM157-0
	CHANCE RIDES MANUFACTURING, INC. 4200 Walker	Release Date:	April 2, 2008
	Wichita, KS 67277-2328	Effective Date:	April 2, 2008
	U.S.A.	Supersedes:	N/A
CHANCE RIDES MANUFACTURING, INC.	Phone: 1-316-942-7411•FAX: 1-316-942-2012		
	Website: www.rides.com	Completion Date:	June 2, 2008
	E-mail: rides@rides.com	Page:	3 of 4
Ride Manufacturer: CHANCE RII	DES MANUFACTURING, INC. Affected Pro	oduction Dates: All	
Ride Name: C.P. HUNTI	NGTON Affected Se		nits With 2.5L Engine
Model No.: 102			
Detail of Issue (continued):			
	A :	aampraaaar bro	akat
M10-1.5 x 35mm caps	crew	compressor bra	ickei
with 10mm special locking at this location	washer		b
(See Detail View on nex	t page)	() ()	
	· · · · · · · · · · · · · · · · · · ·		\sim \sim
		/	
		D D	lor L
		o	
M10-1.5 x 40mm capsci	ew A O	0+0	
with special locking wash at these locations		<u> </u>	
See Detail View on next p			
		4+++	
		ALLE	I III
M8-1.25 x 40mm caps	screw	What has	
with 5/16 special locking			
at this location (See Detail View on nex	t page)	M10-1.5 x	
,		at this	
	(See Detail Viev	v on next page)

	CHANCE RIDES MANUFACTURING, INC.	Bulletin No:	B102CRM157-0	
		Release Date:	April 2, 2008	
	4200 Walker Wichita, KS 67277-2328	Effective Date:	April 2, 2008	
	U.S.A.	Supersedes:	N/A	
CHANCE RIDES MANUFACTURING, INC.	Phone: 1-316-942-7411 • FAX: 1-316-942-2012			
	Website: www.rides.com	Completion Date:	June 2, 2008	
	E-mail: rides@rides.com	Page:	4 of 4	
Ride Manufacturer: CHANCE RIE		duction Dates: All		
Ride Name: C.P. HUNTIN	NGTON Affected Se	vialNos · A111	Jnits With	
			2.5L Engine	
Model No.: 102				
Detail of Issue (continued): Image: Service of Coarse service of Coarse service of Service of Coarse service of				
Coarse serrations	the mounted con follows:	HER SET Nut on Stud must be installe parse serration ed with each o ns must be aga	ns of the two ther as shown. ainst the nut and ten the nuts as	