

MaxFlight

C O R P O R A T I O N

MaxFlight Corporation
750 Airport Road
Lakehurst, NJ 08701-8507 USA

1 (732) 842-8898
fax 1 (732) 842-1114
www.maxflight.com

SERVICE BULLETIN

To: _____
From: Rich Mascolo
Fax: +1 (732) 842-1114
Company: _____
Voice: +1 (732) 842-9898 235
Subject: MaxFlight Safety Service Bulletin 2000-00
Sent: 4/13/00 at 5:30:00 PM
Pages: 1 (including cover)

MESSAGE

Units Affected: All MaxFlight Simulators [VR2000, VR2002, VR2500 and MT3000]

Purpose: To ensure security of both Pitch and Roll Encoders

Action/Requirement: URGENT - SAFETY Bulletin

Instructions to comply with this SAFETY Bulletin:

- Locate the two set screws on the pitch encoder collar, remove and re-install using Blue Loc-Tite and ensure that the screws are tightened firmly.
- Locate the one set screw on the roll motor encoder shaft collar, remove and re-install using Blue Loc-Tite and ensure that the screw is tightened firmly.

We have made it a weekly requirement to inspect both encoders for security and set screws for tightness. Please add this requirement to your present weekly inspection.


IMPORTANT!

Please CONFIRM RECEIPT of this Service Bulletin by faxing this cover page with your signature to MaxFlight Corporation at +1 (732) 842-1114 within 2 days.


Signature (confirming receipt): _____

URGENT

Rev.	Description	Date	Appr.
002	Revision	2-16-00	

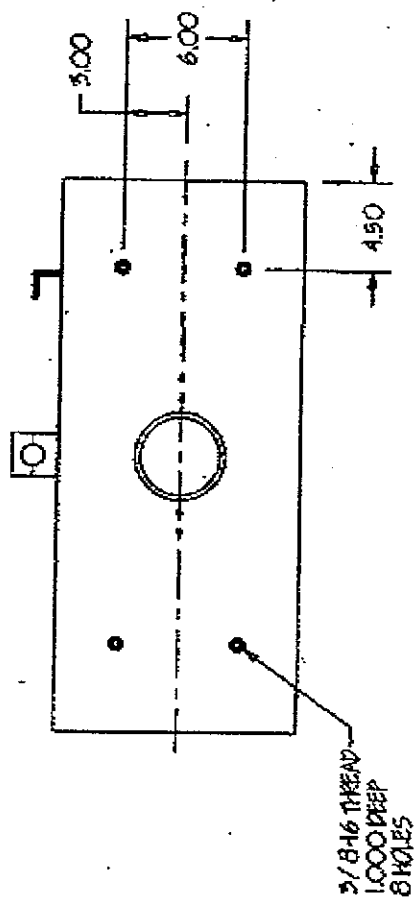

NOTES:
1. BREAK ALL SHARP EDGES.
2. SIZES ARE IN INCHES.

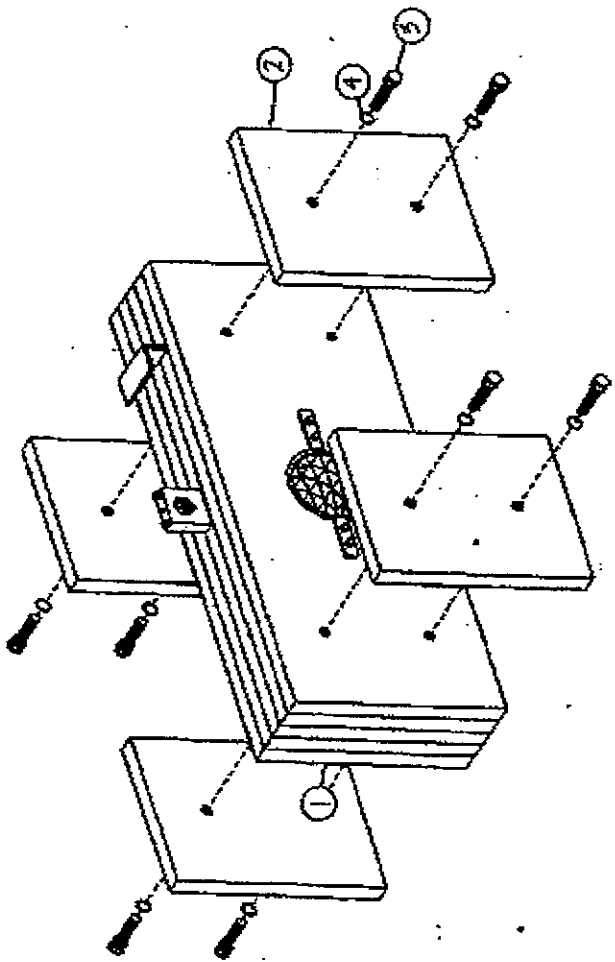

ITEM	QTY.	DESCRIPTION (PART NO.)
4	8	0070 3/8" Lock Washer
3	8	0080 3/8-16 1/2" AHSI Bolt
2	4	A9-02 Counterweight Add On Plate
1	1	510-005 W2002 Counterweight Assembly

Part List

Title: Counterweight Add On Plate Assembly

Meadlight Corp.
750 Airport Road
Lakewood, NJ 08101
(732) 942-9898
Fax: (732) 942-1114
P/N: 510-005 A

Scale: None
Date: 12-08-99
Appr'd By: [Signature]
Date: 2/16/00