## Majestic Manufacturing, Inc.

Majestic Manufacturing, Inc. \* PO Box 128 4536 State Route 7, New Waterford, Ohio 44445

Subject: Raising & Lowering Decks

## ATTN: OWNER/OPERATOR

This bulletin pertains to the operation of your Majestic unit. This Service Bulletin <u>must</u> remain with the owner's manual at <u>all</u> times. If you have any questions regarding the Bulletin, contact our office at 330/457-2447, M-F 8:00a.m. -4:30p.m. E.S.T. \*\* Fax 330/457-7490.

# **SERVICE BULLETIN**

Date: February 13, 1991

**S.B.** Number: 91-1 Sheet 1 of 2

#### Notice:

Majestic Manufacturing, Inc. indicates in the owner's manual about the safe guards and hazards of raising and lowering the Majestic Scooter decks. In addition, Majestic Manufacturing will be issuing operational placards along with instructions and hardware to be placed on each and every Majestic Scooter. This placard is designed to inform the owner/operator of the correct and safe operation in the erection and dismantling of the scooter.


If you have any questions on factory standards or procedures on our equipment, contact Majestic Manufacturing, Inc. during normal business hours of 8:00 a.m. to 4:30 p.m. Monday through Friday, E.S.T. at 330/457-2447 or toll free at 1-888-MAJ-RIDE.


# Majestic Manufacturing, Inc.

Majestic Manufacturing, Inc. \* PO Box 128 4536 State Route 7, New Waterford, Ohio 44445

Instructions for Installing Warning Decal:
Using the holes in the decal, Locate & drill a 13/64" dia. Hole in the side panels.

Pop rivet in place

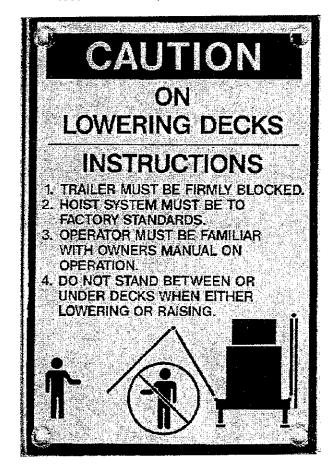

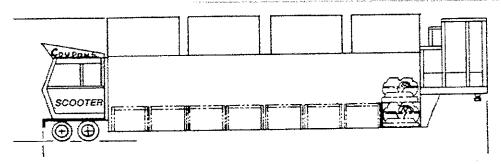

Location of Warning Label

Note: Warning label must be located on the unit in such a way that it is visible to any person prior to lowering or raising the decks.

## Majestic Manufacturing, Inc.

Majestic Manufacturing, Inc. \* PO Box 128 4536 State Route 7, New Waterford, Ohio 44445

Subject: Raising & Lowering Decks Supplement

## ATTN: OWNER/OPERATOR

This bulletin pertains to the operation of your Majestic unit. This Service Bulletin <u>must</u> remain with the owner's manual at <u>all</u> times. If you have any questions regarding the Bulletin, contact our office at 330/457-2447, M-F 8:00a.m. -4:30p.m. E.S.T. \*\* Fax 330/457-7490.

# SERVICE BULLETIN

Date: May 1, 1991

S.B. Number: S.B. 91-1 Supplement to Service Bulletin 91-1

#### Notice:

Service Bulletin 91-1 and the safety decal referred to; emphasize the importance of maintaining the hoist system to "FACTORY STANDARDS". This supplemental letter is being supplied to all of our customers explaining what the phrase "FACTORY STANDARDS" means.

### **DECK OPERATING CABLES:**

- 1. Inspect hoist cables for:
  - A. Rust appears to come from the interior of the cable.
  - B. Evidence of previous corrosion from the pitted condition of the wires.
- Severe stretching occurring in a short section of a cable indicated by a in the cable.
- 3. Severe damage such as "kinking", broken strands or "bird caging" of the cable.
- 4. Any strand or strands broken 5% or more.
- If cables are found damaged they must be replaced. Both cables must be replaced at the same time.

### 12-VOLT BATTERY:

1. Must be at a "FULL CHARGE" at all times to insure proper operation of the 12-volt winch motor.

If you have any questions on factory standards or procedures on our equipment, contact Majestic Manufacturing, Inc. during normal business hours of 8:00 a.m. to 4:30 p.m. Monday through Friday, E.S.T. at 330/457-2447 or toll free at 1-888-MAJ-RIDE.