



<p>ZAMPERLA INC. 49 Fanny Road Parsippany, New Jersey 07054-6545 USA Phone: 973 334 8133 Fax: 973 334 6880</p>		<p>Bulletin No: 2006 EP01 Release Date: November 9, 2006 Effective Date: November 9, 2006 Supersedes: N/A Completion Date: February 9, 2007 Page: 1 of 2</p>
SERVICE BULLETIN		
Ride Manufacturer: CALP srl	Affected Production Dates: All	
Ride Name: El Paso Train	Affected Serial Nos.: All	
Model Number: El Paso Train		
Abstract Of Issue:		
Guarding to be added.		
Reason For Release:		
The possibility exists for a rider in the locomotive (front car only) to reach under the car and engage a pinch point between the wheel and the track.		
Action To Be Taken:		
<p>Instruct operators to remain alert to immediately stop the ride if any passenger fails to remain properly seated. The operator must watch the passengers throughout the ride. These requirements remain unchanged. As soon as possible, but no later than February 9, 2007, install guards on the locomotive as indicated in page 2.</p> <p>The guard is available for purchase. Please allow sufficient ordering time.</p>		
Detail Of Issue:		
See page two, which shows the guard.		
Future Action To Be Taken:		
<p>On a daily basis inspect the guard to verify that it is securely in place before operating the ride. Ensure operators are properly trained. Instruct all riders to remain properly seated, with hands, arms and legs in the car while ride is in motion.</p>		

Bulletin 2006 EP01 Page 2 of 2

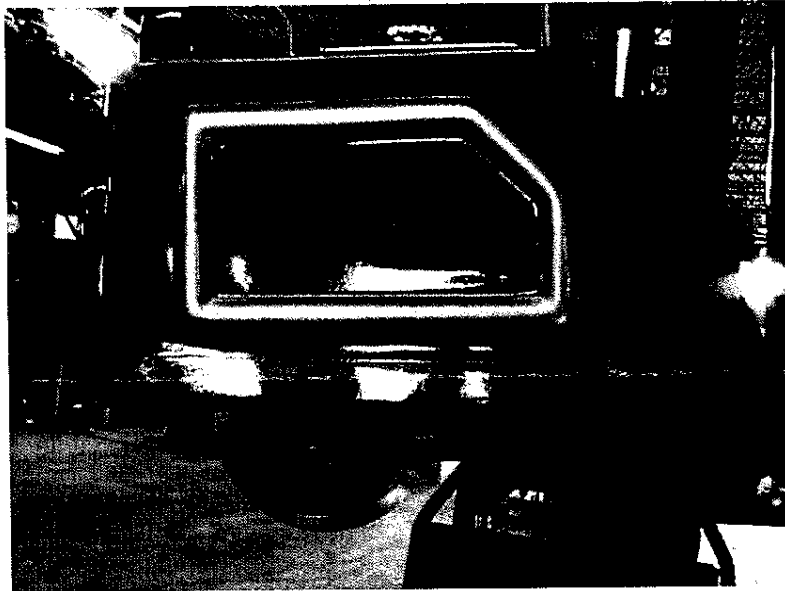

Before (no guard)

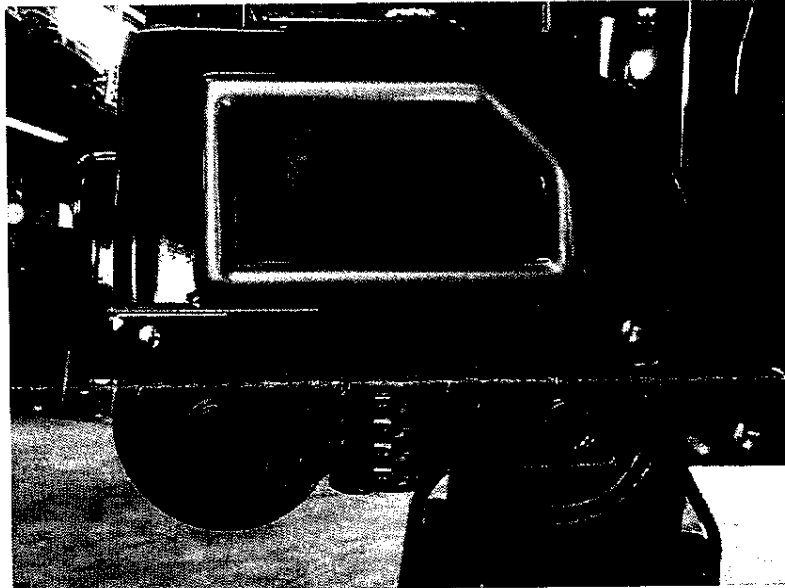

After (with purchased guard)